


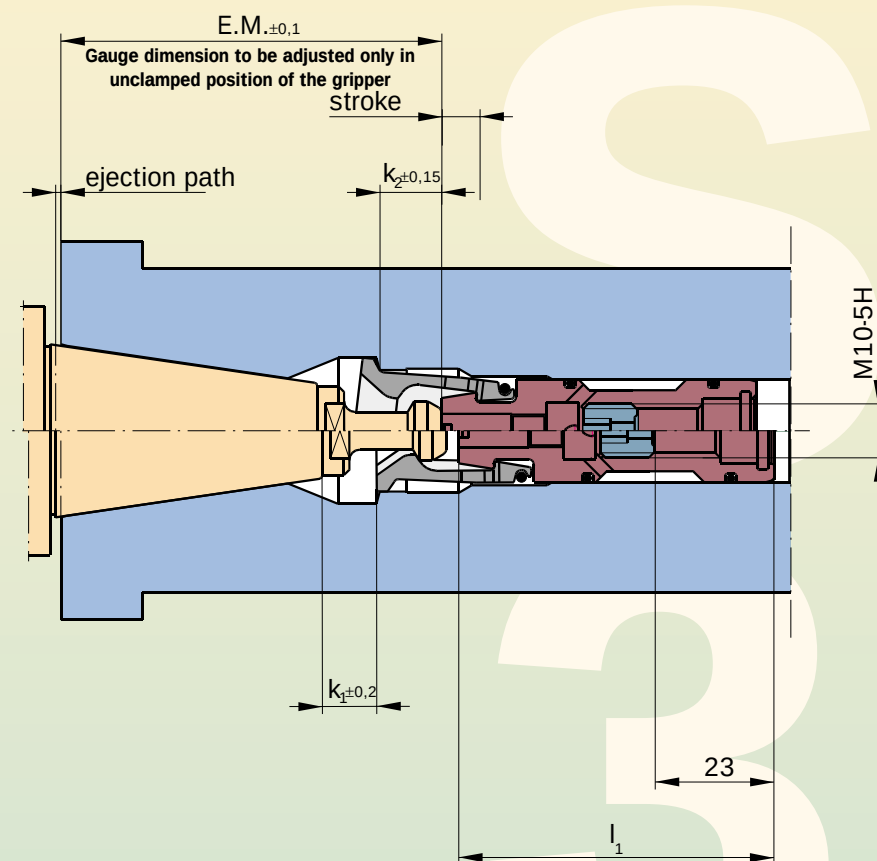

tool standard	code
DIN 69871/69872 ISO 7388/1/2 Typ A	A1
ANSI B 5.50 - 78 ISO 7388/1/2 Typ B	C1
MAS 403-1982 BT/PT 2 (30°)	E1
MAS 403-1982 BT/PT 1 (45°)	F1
medium transfer	
without transfer	1
axial transfer	2
radial transfer	3

rated quantity		SK 30			
code		A1	C1	E1	F1
medium transfer		1 / 2 / 3			
$\overline{N}$	pull in force	6000	5500		
[mm]	stroke	5,5	5,5	5,5	5,5
	ejection path	0,95	1,6	0,95	0,95
	reference gauge	70,7	57,7	70,4	70,4
	k_1	11,2	11,2	10,6	10,6
	k_2	11,7	-1,3	11,4	11,4
	l_1	57,5	72	57,5	57,5
order no.	mounting tool	95.101.280.9.2	95.101.280.9.2	95.101.280.9.2	95.101.280.9.2